

# GAS SPRING HEAVY DUTY

## Note:

Initial spring force at 150 bar = 20000 daN

Order No for spare parts kit: 2488.13.20000

Gas spring without valve

Order No (example): 2488.13.20000. .P

Pressure medium: Nitrogen N<sub>2</sub>

Max. filling pressure: 150 bar

Min. filling pressure: 25 bar

Working temperature: 0°C to +80°C


Temperature related force increase: ± 0.3%/°C

Max. recommended extensions per minute:


approx. 15 to 100 (at 20°C)

Max. piston speed: 1.6 m/s

## 2488.13.20000.

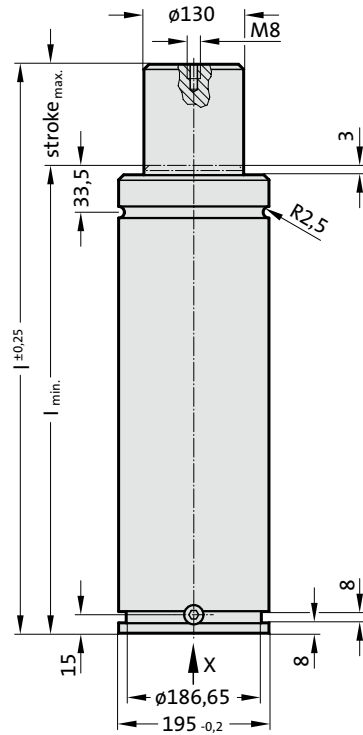

View X

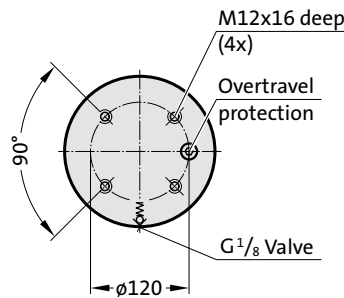


2488.13.20000.


Gas spring HEAVY DUTY

Order No	Stroke <sub>max.</sub> (s)	l <sub>min.</sub>	l
2488.13.20000.025	25	185	210
2488.13.20000.038	38	198	236
2488.13.20000.050	50	210	260
2488.13.20000.063	63	223	286
2488.13.20000.075	75	235	310
2488.13.20000.080	80	240	320
2488.13.20000.100	100	260	360
2488.13.20000.125	125	285	410
2488.13.20000.150	150	310	460
2488.13.20000.160	160	320	480
2488.13.20000.175	175	335	510
2488.13.20000.200	200	360	560
2488.13.20000.250	250	410	660
2488.13.20000.300	300	460	760

Initial spring force versus charge pressure

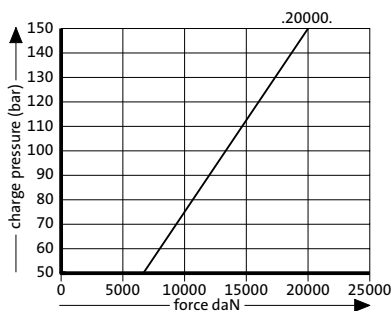

Spring force Diagram displacement versus stroke rise

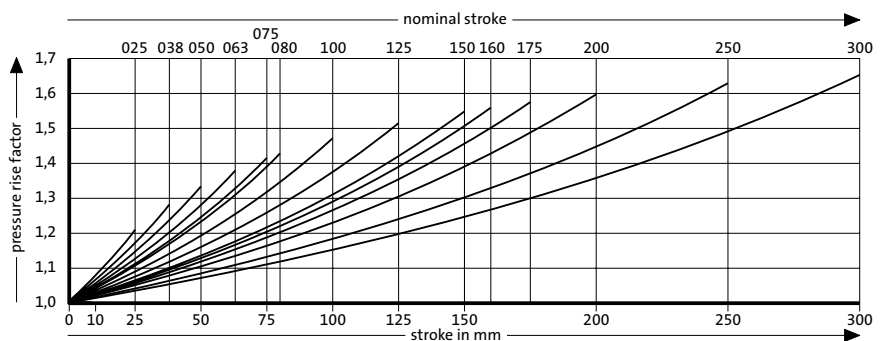

Pressure rise factor accounts for displacement but not external influences!